

# Energy performance certificate (EPC)

14b Old Church Road  
CLEVEDON  
BS21 6NA

Energy rating

**E**

Valid until: **11 April 2032**

Certificate  
number: **9127-3015-0204-7572-3204**

## Property type

Top-floor flat

## Total floor area

59 square metres

## Rules on letting this property


Properties can be rented if they have an energy rating from A to E.

If the property is rated F or G, it cannot be let, unless an exemption has been registered. You can read [guidance for landlords on the regulations and exemptions](https://www.gov.uk/guidance/domestic-private-rented-property-minimum-energy-efficiency-standard-landlord-guidance) (<https://www.gov.uk/guidance/domestic-private-rented-property-minimum-energy-efficiency-standard-landlord-guidance>).

## Energy efficiency rating for this property

This property's current energy rating is E. It has the potential to be D.

[See how to improve this property's energy performance.](#)

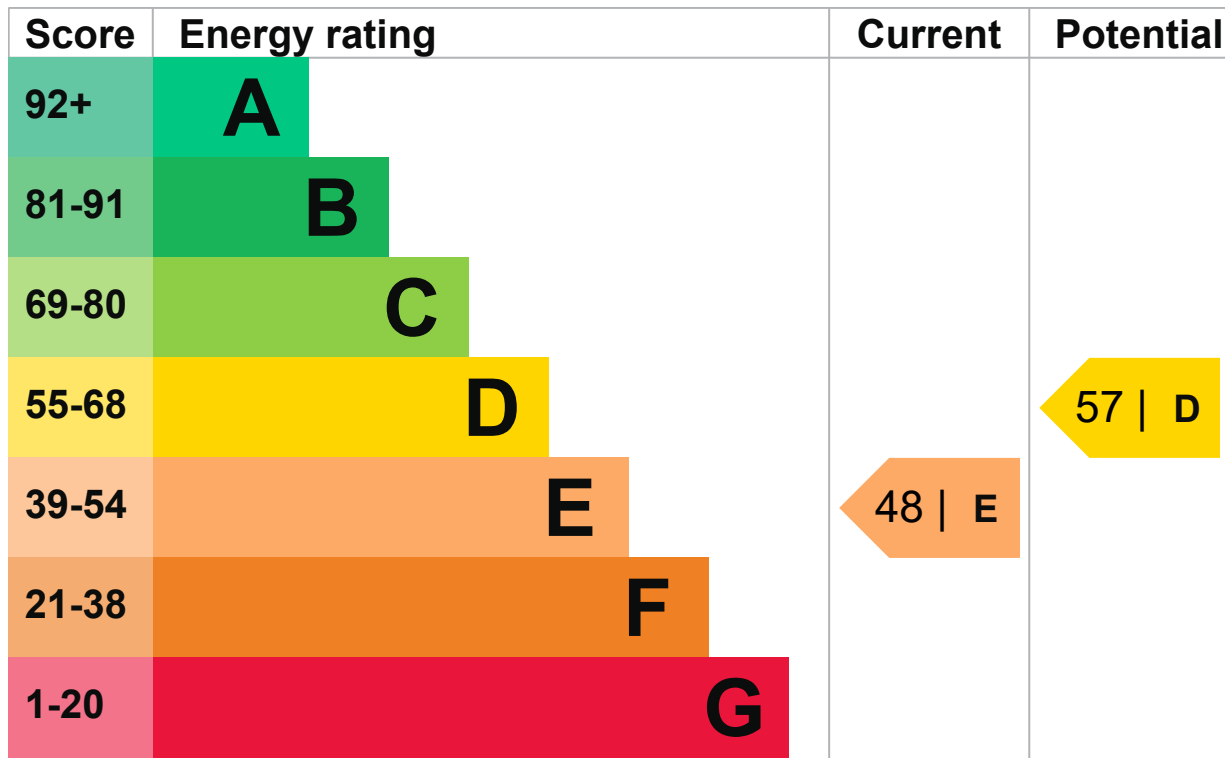

The graph shows this property's current and potential energy efficiency.

Properties are given a rating from A (most efficient) to G (least efficient).

Properties are also given a score. The higher the number the lower your fuel bills are likely to be.

For properties in England and Wales:

- the average energy rating is D
- the average energy score is 60

### Breakdown of property's energy performance

This section shows the energy performance for features of this property. The assessment does not consider the condition of a feature and how well it is working.

Each feature is assessed as one of the following:

- very good (most efficient)
- good
- average
- poor
- very poor (least efficient)

When the description says "assumed", it means that the feature could not be inspected and an assumption has been made based on the property's age and type.

Feature	Description	Rating
Wall	Sandstone or limestone, as built, no insulation (assumed)	Poor
Wall	Solid brick, as built, no insulation (assumed)	Poor
Wall	Timber frame, as built, no insulation (assumed)	Very poor

Feature	Description	Rating
Roof	Pitched, no insulation (assumed)	Very poor
Window	Partial double glazing	Poor
Main heating	Boiler and radiators, mains gas	Good
Main heating control	Programmer, TRVs and bypass	Average
Hot water	From main system	Good
Lighting	Low energy lighting in 50% of fixed outlets	Good
Floor	(another dwelling below)	N/A
Secondary heating	Room heaters, dual fuel (mineral and wood)	N/A

## Primary energy use

The primary energy use for this property per year is 395 kilowatt hours per square metre (kWh/m<sup>2</sup>).

► [What is primary energy use?](#)

## Additional information

Additional information about this property:

- Stone walls present, not insulated

### Environmental impact of this property

This property's current environmental impact rating is E. It has the potential to be E.

Properties are rated in a scale from A to G based on how much carbon dioxide (CO<sub>2</sub>) they produce.

Properties with an A rating produce less CO<sub>2</sub> than G rated properties.

### An average household produces

6 tonnes of CO<sub>2</sub>

### This property produces

4.3 tonnes of CO<sub>2</sub>

### This property's potential production

3.5 tonnes of CO<sub>2</sub>

By making the [recommended changes](#), you could reduce this property's CO<sub>2</sub> emissions by 0.8 tonnes per year. This will help to protect the environment.

Environmental impact ratings are based on assumptions about average occupancy and energy use. They may not reflect how energy is consumed by the people living at the property.

## How to improve this property's energy performance

Making any of the recommended changes will improve this property's energy efficiency.

If you make all of the recommended changes, this will improve the property's energy rating and score from E (48) to D (57).

► [What is an energy rating?](#)



### Recommendation 1: Internal or external wall insulation

Internal or external wall insulation

#### Typical installation cost

£4,000 - £14,000

#### Typical yearly saving

£77

#### Potential rating after carrying out recommendation 1

53 | E

### Recommendation 2: Low energy lighting

Low energy lighting

#### Typical installation cost

£15

#### Typical yearly saving

£24

#### Potential rating after carrying out recommendations 1 and 2

54 | E

### Recommendation 3: Heating controls (room thermostat)

Heating controls (room thermostat)

#### Typical installation cost

£350 - £450

## Typical yearly saving

£29

## Potential rating after carrying out recommendations 1 to 3

55 | D

## Recommendation 4: Double glazed windows

Replace single glazed windows with low-E double glazed windows

### Typical installation cost

£3,300 - £6,500

## Typical yearly saving

£24

## Potential rating after carrying out recommendations 1 to 4

57 | D

## Paying for energy improvements

[Find energy grants and ways to save energy in your home. \(https://www.gov.uk/improve-energy-efficiency\)](https://www.gov.uk/improve-energy-efficiency)

### Estimated energy use and potential savings

### Estimated yearly energy cost for this property

£917

### Potential saving

£152

The estimated cost shows how much the average household would spend in this property for heating, lighting and hot water. It is not based on how energy is used by the people living at the property.

The estimated saving is based on making all of the recommendations in [how to improve this property's energy performance](#).

For advice on how to reduce your energy bills visit [Simple Energy Advice \(https://www.simpleenergyadvice.org.uk/\)](https://www.simpleenergyadvice.org.uk/).

## Heating use in this property

Heating a property usually makes up the majority of energy costs.

### Estimated energy used to heat this property

## Space heating

11779 kWh per year

---

## Water heating

1845 kWh per year

---

## Potential energy savings by installing insulation

Type of insulation	Amount of energy saved
Loft insulation	5025 kWh per year
Solid wall insulation	1636 kWh per year

---

## Contacting the assessor and accreditation scheme

This EPC was created by a qualified energy assessor.

If you are unhappy about your property's energy assessment or certificate, you can complain to the assessor directly.

If you are still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

Accreditation schemes are appointed by the government to ensure that assessors are qualified to carry out EPC assessments.

## Assessor contact details

### Assessor's name

Stuart Skelton

---

### Telephone

07875955805

---

### Email

[stuart@westcountryepc.co.uk](mailto:stuart@westcountryepc.co.uk)

---

## Accreditation scheme contact details

### Accreditation scheme

Elmhurst Energy Systems Ltd

---

### Assessor ID

EES/010197

---

### Telephone

01455 883 250

**Email**[enquiries@elmhurstenergy.co.uk](mailto:enquiries@elmhurstenergy.co.uk)

---

**Assessment details****Assessor's declaration**No related party

---

**Date of assessment**12 April 2022

---

**Date of certificate**12 April 2022

---

**Type of assessment**▶ [RdSAP](#)

---

**Other certificates for this property**

If you are aware of previous certificates for this property and they are not listed here, please contact us at [dluhc.digital-services@levellingup.gov.uk](mailto:dluhc.digital-services@levellingup.gov.uk) or call our helpdesk on 020 3829 0748.

**Certificate number**[9008-3904-6209-9339-1944 \(/energy-certificate/9008-3904-6209-9339-1944\)](#)**Expired on**9 November 2021

---